




LED1550-35 series

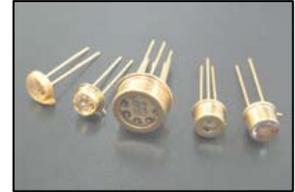

TECHNICAL DATA

Infrared LED

InGaAsP

LED1550-35 series are InGaAsP LEDs mounted on a metal stemp and covered with epoxy resin or glass lens can.

On forward bias, it emits a spectral band of radiation, which peaks at 1550 nm.

Specifications

- Structure: InGaAsP
- Peak Wavelength: typ. 1550 nm
- Optical Output Power: typ. ≤ 2.0 mW
- Resin Material: Epoxy resin or glass lens cap
- Solder: Lead free



Absolute Maximum Ratings ($T_a=25^\circ\text{C}$)

Type	Symbol	Value	Unit
Power Dissipation	P_D	120	mW
Forward Current	I_F	100	mA
Pulse Forward Current *1	I_{FP}	1000	mA
Reverse Voltage	V_R	5	V
Operating Temperature	T_{OP}	-20 ... +90	$^\circ\text{C}$
Storage Temperature	T_{STG}	-30 ... +100	$^\circ\text{C}$
Soldering Temperature *2	T_{SOL}	265	$^\circ\text{C}$

*1 duty = 1%, pulse width = 10 μs

*2 must be completed within 5 seconds

Electro-Optical Characteristics ($T_a=25^\circ\text{C}$)

Item	Symbol	Condition	Min.	Typ.	Max.	Unit
Forward Voltage	V_F	$I_F = 50$ mA	-	1.10	1.40	V
Reverse Current	I_R	$V_R = 5$ V	-	-	10	μA
Peak Wavelength	λ_P	$I_F = 50$ mA	1500	1550	1600	nm
Half Width	$\Delta\lambda$	$I_F = 50$ mA	-	100	-	nm
Rise Time	t_r	$I_F = 50$ mA	-	10	-	ns
Fall Time	t_f	$I_F = 50$ mA	-	10	-	ns

Characteristics of Radiant Power ($T_a=25^\circ\text{C}$)

Type	Radiation Power ($I_F = 50$ mA) [Unit: mW]			Viewing Half Angle [$\Theta_{1/2}$]
	Min.	Typ.	Max.	
LED1550-35K00		1.6		$\pm 50^\circ$
LED1550-35K42		2.0		$\pm 6^\circ$
LED1550-35M00		2.0		$\pm 50^\circ$
LED1550-35M32		2.0		$\pm 15^\circ$
LED1550-35T52		1.2		$\pm 55^\circ$

Radiant Power is measured by Ando Optical Multi Meter AQ2140 & AQ2742

Note: Do not view directly into the emitting area of the LED during operation!

The above specifications are for reference purpose only and subjected to change without prior notice.



Outer Dimensions [Unit: mm]

<p>35K00</p> <p>Technical drawing of LED package 35K00. Dimensions include: epoxy resin, $\phi 5.4 \pm 0.2$, $\phi 4.2 \pm 0.2$, 2.2 ± 0.3, 1.2 typ, 14 ± 1, $2 - \phi 0.45$, 2.5, $\phi 1.0$, $\phi 0.8$, $\phi 0.6$. Labels: ① cathode, ② anode.</p>	<p>35K42</p> <p>Technical drawing of LED package 35K42. Dimensions include: Glass Lens, Plated with Au, $\phi 5.4 \pm 0.2$, $\phi 4.7 \pm 0.1$, $\phi 4.0 \pm 0.1$, 3.8 ± 0.2, 4.85 ± 0.2, 14 ± 1, $2 - \phi 0.45$, 2.5, $\phi 1.0$, $\phi 0.8$, $\phi 0.6$. Labels: ① cathode, ② anode.</p>
<p>35M00</p> <p>Technical drawing of LED package 35M00. Dimensions include: epoxy resin, $\phi 5.4 \pm 0.2$, $\phi 4.2 \pm 0.2$, 3.5 ± 0.5, 14 ± 1, $2 - \phi 0.45$, 2.5, $\phi 1.0$, $\phi 0.8$, $\phi 0.6$. Labels: ① cathode, ② anode.</p>	<p>35M32</p> <p>Technical drawing of LED package 35M32. Dimensions include: Glass Lens, Plated with Au, $\phi 5.4 \pm 0.2$, $\phi 4.7 \pm 0.1$, $\phi 4.0 \pm 0.1$, 4.5 ± 0.3, 6.2 ± 0.3, 14 ± 1, $2 - \phi 0.45$, 2.5, $\phi 1.0$, $\phi 0.8$, $\phi 0.6$. Labels: ① cathode, ② anode.</p>
<p>35T52</p> <p>Technical drawing of LED package 35T52. Dimensions include: Plated with Au, $\phi 4.6$, $\phi 2.4$, 3.3 ± 0.2, 2.0, 14 ± 1, $2 - \phi 0.45$, 2.5, $\phi 1.0$, $\phi 0.8$, $\phi 0.6$. Labels: ① cathode, ② anode.</p>	



Precaution for Use

1. Cautions


- DO NOT look directly into the emitted light or look through the optical system. To prevent in adequate exposure of the radiation, wear protective glasses.

2. Lead Forming

- When forming leads, the leads should be bent at a point at least 3 mm from the base of the lead. DO NOT use the base of the leadframe as a fulcrum during lead forming.
- Lead forming should be done before soldering.
- DO NOT apply any bending stress to the base of the lead. The stress to the base may damage the LED's characteristics or it may break the LEDs.
- When mounted the LEDs onto the printed circuit board, the holes on the circuit board should be exactly aligned with the leads of LEDs. If the LEDs are mounted with stress at the leads, it causes deterioration of the lead and it will degrade the LEDs.

3. Soldering Conditions

- Solder the LEDs no closer than 3 mm from the base of the lead.
- DO NOT apply any stress to the lead particularly when heat.
- The LEDs must not be reposition after soldering.
- After soldering the LEDs, the lead should be protected from mechanical shock or vibration until the LEDs return to room temperature.
- When it is necessary to clamp the LEDs to prevent soldering failure, it is important to minimize the mechanical stress on the LEDs.
- Cut the LED leads at room temperature. Cutting the leads at high temperature may cause the failure of the LEDs.

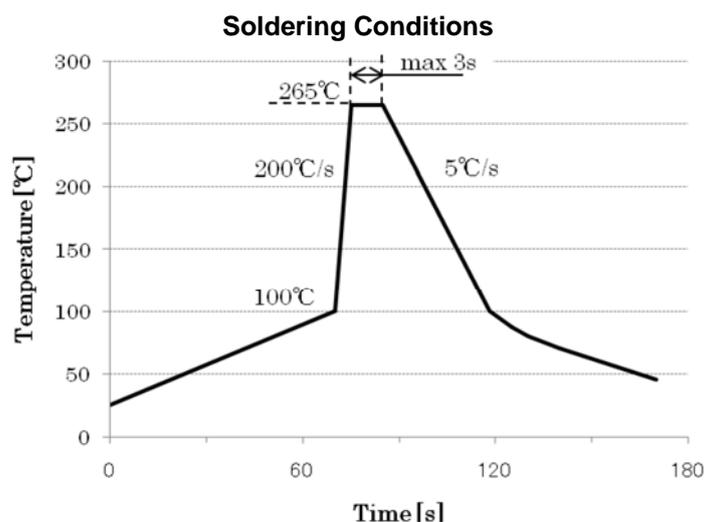

4. Static Electricity

- The LEDs are very sensitive to Static Electricity and surge voltage. So it is recommended that a wrist band or an anti-electrostatic glove be used when handling the LEDs.
- All devices, equipment and machinery must be grounded properly. It is recommended that precautions should be taken against surge voltage to the equipment that mounts the LEDs.