

ROITHNER LASERTECHNIK GMBH

WIEDNER HAUPTSTRASSE 76 IO40 VIENNA AUSTRIA TEL. +43 I 586 52 43 -0, FAX. -44, OFFICE@ROITHNER-LASER.COM



LED660N-03



TECHNICAL DATA

Infrared LED, 5 mm

AIGaInP

LED660N-series are AlGaInP LEDs mounted on a lead frame and encapsulated in various types of epoxy lens, which offers different design settings.

On forward bias, it emits a high power radiation of typical 15 mW at a peak wavelength at 660 nm.

Specifications

Structure: AlGaAs

Peak Wavelength: typ. 660 nm
Optical Ouput Power: typ. 15 mW
Resin Material: Epoxy resin

Solder: Lead free



Absolute Maximum Ratings (T_a=25°C)

Туре	Symbol	Value	Unit
Power Dissipation	P_{D}	120	mW
Forward Current	l _F	50	mA
Forward pulsed Current*	I _{FP}	200	mA
Reverse Voltage	V_R	5	V
Junction Temperature	T_J	100	°C
Thermal Resistance	R_{thip}	190	K/W
Operating Temperature	T _{OP}	-30 +80	°C
Storage Temperature	T_{STG}	-40 +100	°C
Soldering Temperature (for 5 sec.)	T _{SOL}	265	°C

^{*} Pulse condition: Duty 1%, Puls Width 10µs

Electro-Optical Characteristics (T_a =25°C)

		•				
Item	Symbol	Condition	Min.	Тур.	Max.	Unit
Forward Voltage	V_{F}	$I_F = 50 \text{ mA}$	-	2.1	2.3	V
Reverse Current	I _R	$V_R = 5 V$	-	-	10	μA
Radiated Power	Po	$I_F = 50 \text{ mA}$	8	15	-	mW
Peak Wavelength	λ_{P}	$I_F = 50 \text{ mA}$	650	660	670	nm
Half Width	Δλ	$I_F = 50 \text{ mA}$	-	18	-	nm
Rise Time	t _r	$I_F = 50 \text{ mA}$	-	80	-	ns
Fall Time	t _f	$I_F = 50 \text{ mA}$	-	80	-	ns

Characteristics of Radiant Intensity ($T_a=25$ °C)

Туре	Viewing Half Angle	Brightness / Radiation Intensity [Unit: mW/sr]	Outer Dimension	
		Тур.		
LED660N-03	±12°	25		Ø 5 mm

^{*} Radiant Power is measured by S3584-08

The above specifications are for reference purpose only and subjected to change without prior notice.

^{*} Brightness is measured by TekTronix J-16




ROITHNER LASERTECHNIK GIRDH








Typical Performance ($T_a=25$ °C)

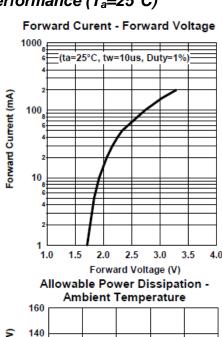



WIEDNER HAUPTSTRASSE 76

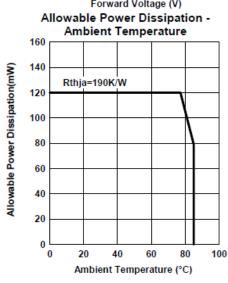

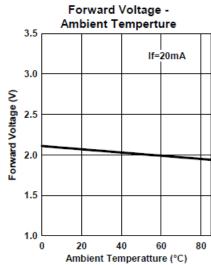

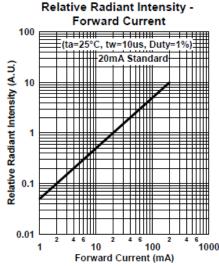

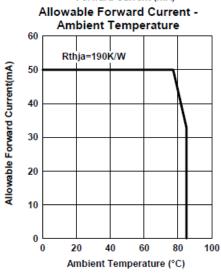

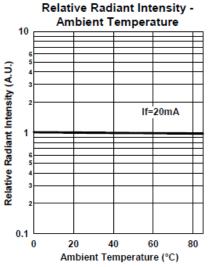





ROITHNER LASERTECHNIK GIRDH



WIEDNER HAUPTSTRASSE 76 IO40 VIENNA AUSTRIA TEL. +43 I 586 52 43 -0, FAX. -44, OFFICE@ROITHNER-LASER.COM

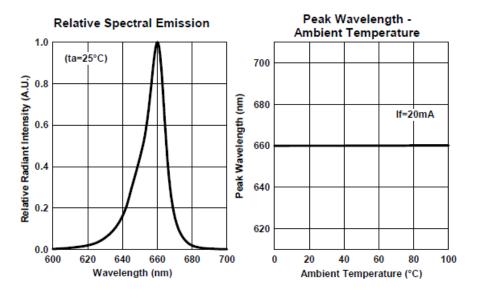

Outer Dimensions

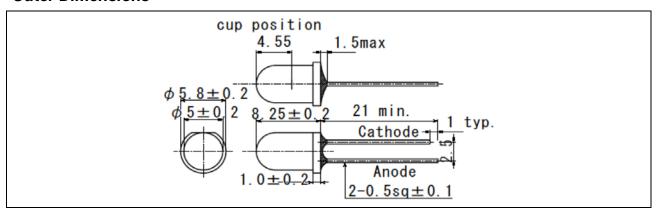

Precaution for Use

1. Cautions

• DO NOT look directly into the emitted light or look through the optical system. To prevent in adequate exposure of the radiation, wear protective glasses.

2. Lead Forming

- When forming leads, the leads should be bent at a point at least 3 mm from the base of the lead. DO
 NOT use the base of the leadframe as a fulcrum during lead forming.
- Lead forming should be done before soldering.
- DO NOT apply any bending stress to the base of the lead. The stress to the base may damage the LED's characteristics or it may break the LEDs.
- When mounted the LEDs onto the printed circuit board, the holes on the circuit board should be
 exactly aligned with the leads of LEDs. If the LEDs are mounted with stress at the leads, it causes
 deterioration of the lead and it will degrade the LEDs.




ROITHNER LASERTECHNIK GMBH

1040 VIENNA AUSTRIA TEL. +43 I 586 52 43 -0, FAX. -44, OFFICE@ROITHNER-LASER.COM



Recommended Land Layout (Unit: mm)

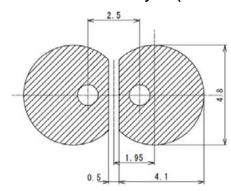


3. Soldering Conditions

Solder the LEDs no closer than 3 mm from the base of the lead.

WIEDNER HAUPTSTRASSE 76

- DO NOT apply any stress to the lead particularly when heat.
- The LEDs must not be reposition after soldering.
- After soldering the LEDs, the lead should be protected from mechanical shock or vibration until the LEDs return to room temperature.
- When it is necessary to clamp the LEDs to prevent soldering failure, it is important to minimize the mechanical stress on the LEDs.
- Cut the LED leads at room temperature. Cutting the leads at high temperature may cause the failure of the LEDs.

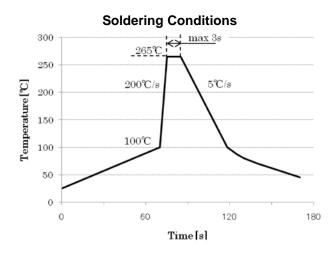

4. Static Electricity

- The LEDs are very sensitive to Static Electricity and surge voltage. So it is recommended that a wrist band or an anti-electrostatic glove be used when handling the LEDs.
- All devices, equipment and machinery must be grounded properly. It is recommended that precautions should be taken against surge voltage to the equipment that mounts the LEDs.